


SOUTH DAKOTA WATER WELL COMPLETION REPORT

07-92

Location S-E 1/4 N-W 1/4 Sec 15 Twp 113 Rg 64
County Beadle North

Please mark well location with an "X"

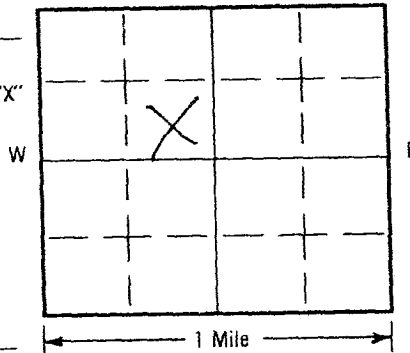

Well Completion Date

9-25-06

LOCATION:

Distance from nearest potential pollution source (septic tank, abandoned well, feed lot, etc.)? NONE ft. from _____ (identify source).

PROPOSED USE:

- ☒ Domestic/Stock ☐ Municipal ☐ Business ☐ Test Holes
☐ Irrigation ☐ Industrial ☐ Institutional ☐ Monitoring well

METHOD OF DRILLING:

Mud RotaryCASING DATA: ☐ Steel ☒ Plastic ☐ Other

If other describe _____

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
<u>200 LB/FT</u>	<u>5 IN</u>	<u>0 FT</u>	<u>110 FT</u>	<u>7 7/8 IN</u>
<u>Sch 80 LB/FT</u>	<u>2 IN</u>	<u>110 FT</u>	<u>1210 FT</u>	<u>4 1/2 IN</u>
_____ LB/FT	_____ IN	_____ FT	_____ FT	_____ IN

GROUTING DATA

Grout Type	No. of Sacks	Grout Weight	From	To
_____	_____	_____ lb./gal	_____ ft.	_____ ft.
_____	_____	_____ lb./gal	_____ ft.	_____ ft.

Describe grouting procedure _____

SCREEN: ☒ Perforated pipe ☐ ManufacturedDiameter 2 IN Length 100 FEETMaterial PVCSlot Size 3/8 Set From 1110 Feet to 1210 Feet

Other information _____

WAS A PACKER OR SEAL USED? ☒ YES ☐ NOIf so, what material? RubberDescribe packer(s) and location? above Perf.

DISINFECTION: Was well disinfected upon completion?

YES, How: _____

☒ NO, Why Not? _____Flowing Well

Laboratory sent to for water quality analysis

Well Owner: Richard Boomsma

Business Name: _____

Address: 19975 394th Ave
Huron S.D. 57350

WELL LOG:

FORMATION	DEPTH	
	FROM	TO
<u>yellow Clay</u>	<u>0</u>	<u>20</u>
<u>Blue Clay</u>	<u>20</u>	<u>70</u>
<u>Shale</u>	<u>70</u>	<u>490</u>
<u>Greenhorn</u>	<u>490</u>	<u>510</u>
<u>Dakota</u>	<u>875</u>	<u>920</u>
<u>Lakota</u>	<u>1110</u>	<u>1210</u>

STATIC WATER LEVEL _____ Feet

If flowing: closed in pressure 20 PSIGPM flow 40 through 2" inch pipeControlled by ☒ Valve ☐ Reducers ☐ Other _____Reduced Flowrate 15 GPMCan well be completely shut in? yes

WELL TEST DATA:

☐ Pumped

Describe: _____

☐ Bailed☐ Other

Pumping Level Below Land Surface

_____ ft. After _____ Hrs. pumped _____ GPM

_____ ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate _____ GPM

REMARKS

This well was drilled under license # 722

And this report is true and accurate.

Drilling firm Stretch's Well Service Inc.

Signature of License Representative:

Tom Gatzert

Signature of Well Owner or Equitable Property Holder:

Date: _____

1-30-07